

LAND CORNER RECORD

Index: N-11	Corner: Quarter between Section 16 and Section 21	State of Indiana - Hoosier National Forest		
Section: 21	Township: 7N	Range: 1E	P.M.: 2nd	County: Monroe
Coordinate:	Lat./N: 1379484.64	Lon./E: 3142681.55	Datum: NAD83(2011) US survey feet	


CORNER HISTORY: (Chronological history of corner)

1.) Date of Survey:	Surveyor:	Monument:	Recording Information:	Monument Photograph:
1986	USFS Surveyor L.S. #S0545	36" Aluminum Monument	On file USFS office.	
Reference Objects:	Species:	Diameter:	Bearing:	Distance:
	Shag Hickory	7"	South	40.9'
	Black Oak	15"	N48°E	43.0'
	CL of Stream	N/A	North	39'
Record evidence of prior survey:	Found aluminum monument			
2.) Date of Survey:	Surveyor:	Monument:	Recording Information:	
04/01/2009	Kevin P. Enright Monroe Co. Surveyor	3" aluminum cap	Monroe County Surveyor Monument Record	
Reference Objects:	Species:	Diameter:	Bearing:	Distance:
	Rebar Post	1/2"	N33°W	1.99'
	Black Oak	24"	N53°E	41.79'
	Shag Hickory	9"	S04°W	40.64'
Record evidence of prior survey:	Found 3" aluminum monument.			

ACCESSORIES: Bearing and distance from monument to witness object.

Reference Objects:	Object or Tree Species:	Diameter:	Bearing:	Distance:
	Mag nail /Shagbark Hickory	8"	S04°W	41.27'
	Black Oak	20"	N52°E	43.15'
	Mag nail Tulip Poplar	14"	N68°W	18.23'
	Rebar Post with sign	1/2"	N34°W	2'
Monument Found or Set:	Found aluminum monument with stamped cap, 0.5' above grade.			


MONUMENT SKETCH

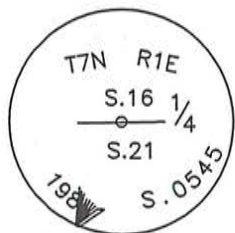

NARRATIVE REFERENCE:

Monument is an aluminum monument with a stamped cap, 0.5 feet above grade, a carsonite post is located 2 feet to the west of the monument. Located 30 feet north of east/west running ridge, 25 feet south of east/west running dry bed, 10 feet north of east/west running walking path, approximately 300 feet north of Allen's Creek Road.

SECTION DIAGRAM

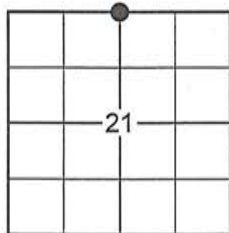

Corner Location = ●

PERPETUATION RECORD:

This monument was set by the USFS as shown on an unsigned USFS survey (c.1980) showing a breakdown of Section 21 (on file in the USFS office). It is 1 foot from the midpoint of a line from the 3 inch galvanized pipe with a brass cap at N-9 (Section Corner common to Sections 16, 17, 20 & 21) and the pipe found at N-13 (Section Corner common to Sections 15, 16, 21, & 22).

The record monument was found undisturbed and maintained by remarking the existing bearing trees or establishing new bearing trees. Two existing bearing trees were recovered from a 1986 Land Corner Record and remarked, one 1/2" rebar post with a Survey Marker sign was recovered, and one new bearing tree was established.

Bearing Trees were marked with a blaze, scribed B.T., bearing tree sign, paint, and nail where permission was granted by adjoining landowner.

Section: 21 T7N R1E

Prepared By: BRG (Project#3-565)

Date: 6/2015

Referenced on BRG survey recorded as InstNo.2016001724


Accepted by the Monroe County Surveyor Review Board on August 6, 2019.

MONUMENT RECORD
State of Indiana - County of Monroe

Section: 21 **Township: 7 North** **Range: 1 East** **Corner ID: Polk K-13**

Monument Description & Remarks: 3" Aluminum cap stamped, "T7N R1E, S.16/S.21 1/4, 198_SO545". Survey Sign 1.5ft above ground at pt. B

References On File: Land Corner Record, Forestry Tie, on file in Surveyor Office

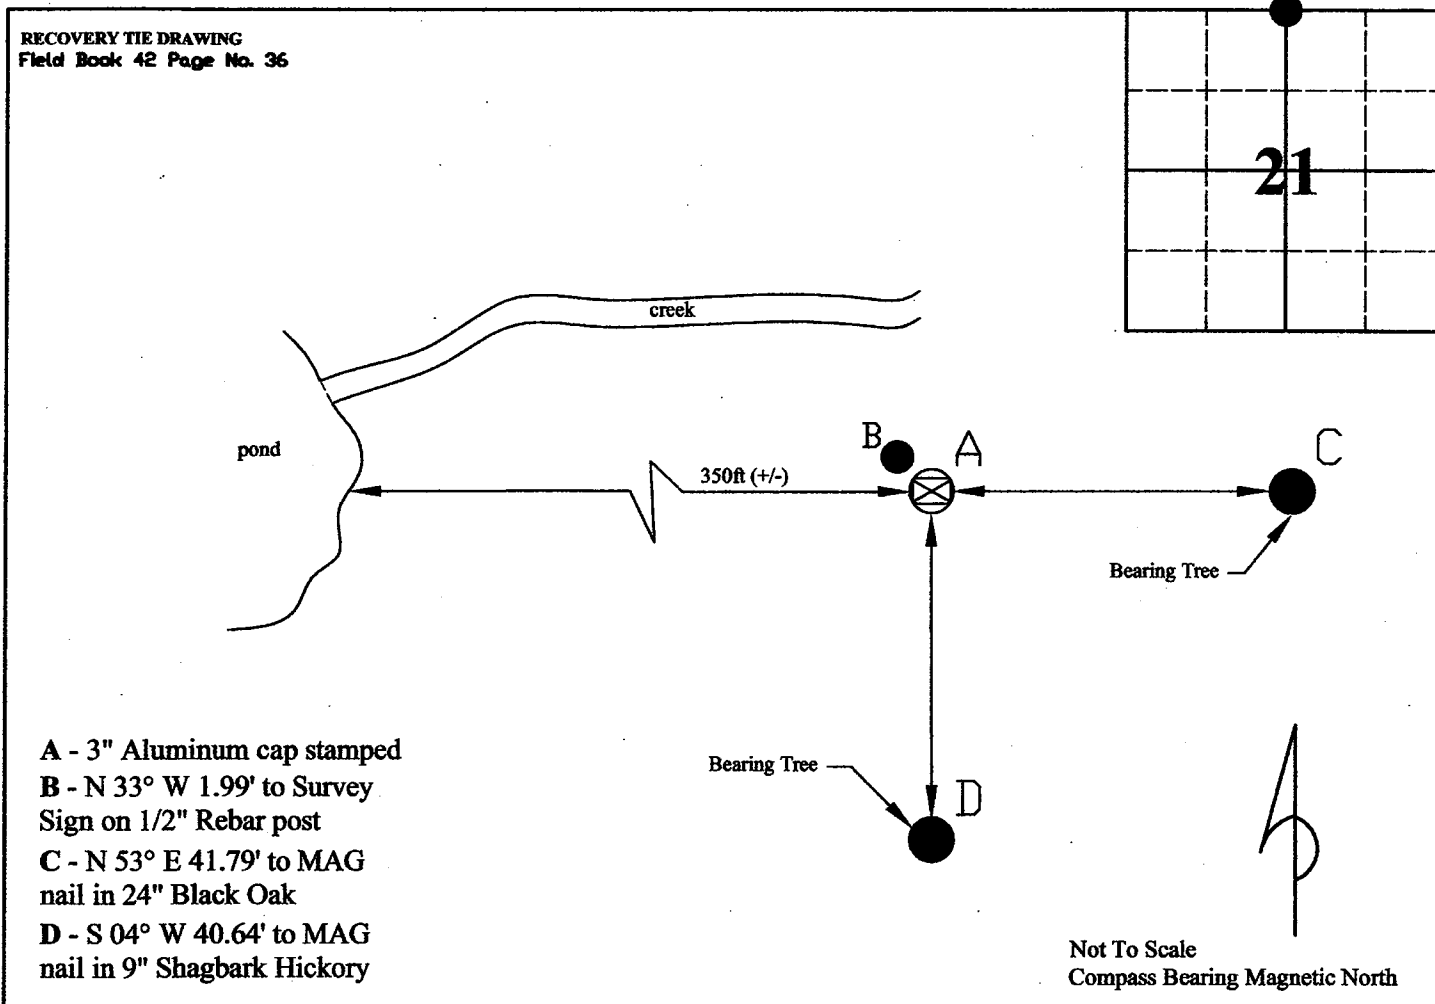


I, Kevin P. Enright, Monroe County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of section 36-2-12-11 of the Indiana Code; and the above data is given under my hand and seal this 1st day of April, 2009.

Kevin P. Enright

Administered by the Monroe County Surveyor Review Board

Date: 4-7-2009

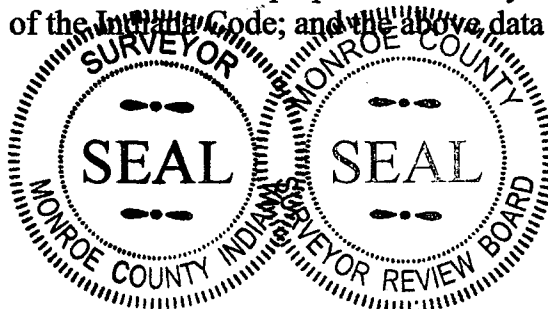


Index No. N11 LAND CORNER RECORD (RECTANGULAR SURVEYS) R9-7100-74 (Rev. 5/80) 826-531

T. 7N R. 11E 2nd Mer. N.F. 160511-2 County MONROE State INDIANA

1/4 Corner common to sections 16 and 21

EXISTING SURVEYS

Original Government Survey		Original Evidence Found	
Year surveyed _____		Year of search _____	By _____
Original monument _____ (Wood post, stone, pile of stones, pipe, etc.)		Monument found _____	
Bearing Trees		Original Bearing Trees Found	
Species _____		Species _____	
Diameter _____		Diameter _____	
Bearing _____		Bearing _____	
Distance _____		Distance _____	
Subsequent Corner Restoration		Evidence of Subsequent Corner Restoration Found	
Year surveyed _____	By _____	Year of search _____	By _____
Where filed or recorded _____			
Monument _____ (Original, concrete post, iron rod, etc.)			
Bearing Trees, Reference Objects		Bearing Trees, Reference Objects	
Species _____			
Diameter _____			
Bearing _____			
Distance _____			

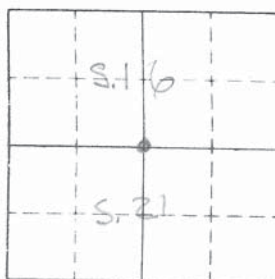

Sketch

○ Corner ☒ F.S. Land

Relation of Evidence to Record Features Along Section Lines

Section line to sections _____

Object _____

Record distance _____


Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any.

Perpetuation Record

Monument and accessories established. Include brief description of area. INSTALLED
36" ALUM MON. 2 1/2" DIAM. W/ MAGNET UNDER CAP. SITS IN A
BOTTOM AREA. MON. 12" ABOVE GROUND. ROCK CAIRN, PAINTED
AROUND. CARBONITE POST SITS 3.7 FT. SOUTH OF MON. BT'S PAINTED
BLACK, SCRIBED & SIGNED.

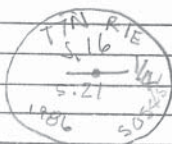

7"	15"	4"
SHAG HICK.	BL. OAK	STREAM
SOUTH	N 48° E	NORTH
40.9 FT.	43.0 FT.	39 FT.

Certified corner restoration certificate prepared. Yes _____ No _____

Filed in county records at _____ Date _____ County Document No. _____

Identified on aerial photo No. _____ Which is filed at _____

Index No. 11-11
(Alphabetical - Numerical)

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

R9-7150-4 (Rev. 6/13/67)
GPO 806-924

T. 7N R. 1E Mer. N.F. 1000 County Monroe State Ind
Section Corner common to sections 16, 21, and

EXISTING SURVEYS

Original Government Survey		Original Evidence Found	
Year surveyed <u>1814</u>		Year of search <u>1973</u>	By <u>H. Denton</u>
Original monument <u>Wood Post</u> (Wood post, stone, pile of stones, pipe, etc.)		Monument found <u>No</u>	
Bearing Trees		Original Bearing Trees Found	
Species <u>Beech</u> <u>Beech</u>		Species	
Diameter <u>6"</u> <u>10"</u>		Diameter	
Bearing <u>S 4 W</u> <u>S 35 W</u>		Bearing	
Distance <u>4 1/2</u> <u>8 1/2</u>		Distance	<u>None</u>
Subsequent Corner Restoration		Evidence of Subsequent Corner Restoration Found	
Year surveyed _____	By _____	Year of search _____	By _____
Where filed or recorded _____			
Monument _____ (Original, concrete post, iron rod, etc.)			
Bearing Trees, Reference Objects		Bearing Trees, Reference Objects	
Species _____			
Diameter _____			
Bearing _____			
Distance _____			



Sketch

○ Corner ☒ F.S. Land

Relation of Evidence to Record Features Along Section Lines

Section line to sections _____
Object _____
Record distance _____
Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any.

Perpetuation Record

Monument and accessories established. Include brief description of area.

At time of search:

1. Did you have the record description?

Yes ☒ No _____

2. How was search area located?

Pacing, chaining, photos, maps, etc. Fences

3. Man hours spent in search 2 hr.

4. Do you think additional search might recover evidence? Yes _____ No ☒

5. Signature H. Denton

Certified corner restoration certificate prepared: Yes _____ No _____

Filed in county records at _____ Date _____ County Document No. _____

Identified on aerial photo No. _____ Which is filed at _____